

# Engineering Bulletin


## Error Code 'C01D' on UTY-RNBYU Wired Remote

The C01D error code is an incompatibility error code between a newer generation wired remote (UTY-RNBYU) and older generation evaporator. The two are compatible with each other but require dip switches to be changed with on the back of the wired remote.

### Affected models:

- 9CQ           •18CL
- 9RQ           •18RL
- 9RLQ         •18RLQ
- 9RL          •18RLX
- 15RLQ       •18RLXS
- 24RL         •24CL
- 24RLQ       •30CLX
- 24RML\*      •30RLXQ
- 24RML1\*    •30RLX
- 24RLX       •36CLX
- 24RLXQ      •36RML\*
- 42RLX       •36RML1\*
- 9R2          •36RLX
- 12R2         •24CL1
- 36CLX1      •30LCX1

\*Excludes all 'RML' cassette models.

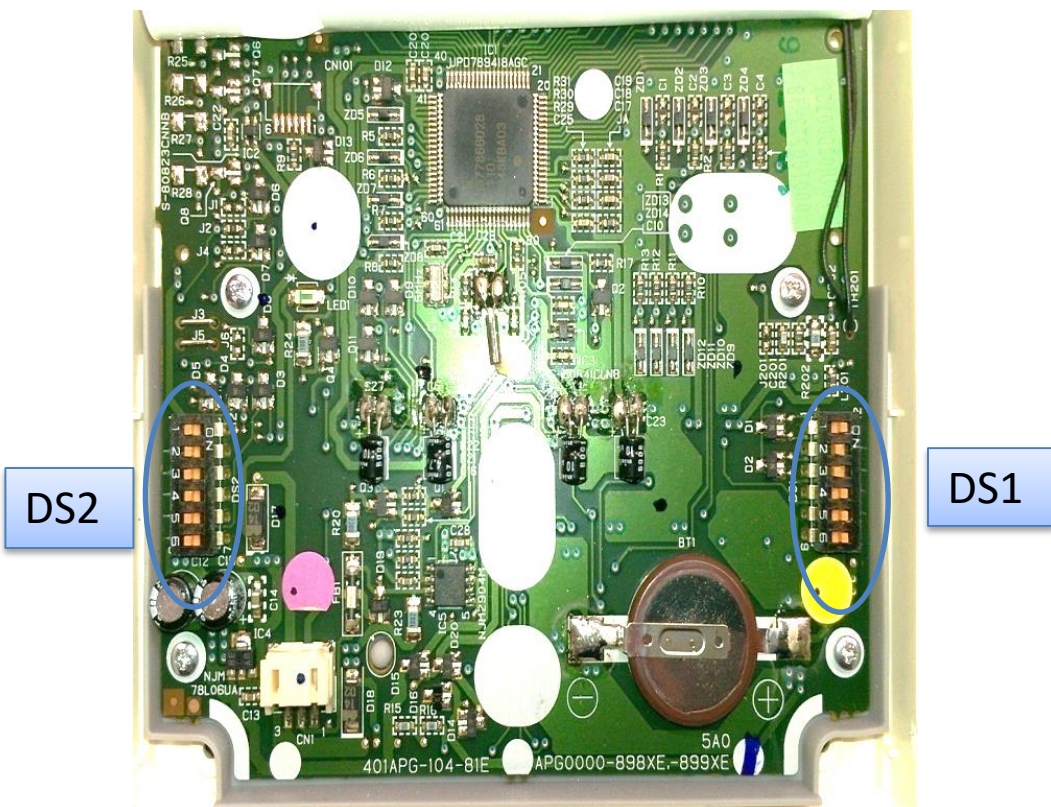

DS2

DS1

\* Factory setting

		Switch state	
		NO.	ON
DIP switch 1	1	*	
	2	*	
	3	*	
	4		*
	5	*	
	6	*	

Back of wired remote

Power needs to be turned off first on outdoor disconnect. Dip switches to be changed from 'OFF to 'ON' are: #s 1, 5, & 6 and are located on DS1.  
\*\*Please note: dip switches do not need to be changed for 9RLS, 12RLS, or 15RLS

**Disclaimer:** In order to perform some of these tests an electrical and/or refrigerant license is required. We strongly advise to check the Service manual for more detailed explanation. If you are not sure about these recommendations please contact us at 866-952-8324.